

# primo

## COMPACT

**FRESH MILK  
MAINTENANCE**

**YEARLY**

westomatic  
*make it happen*




# FRESH MILK MAINTENANCE KIT

It is recommended that you complete a yearly maintenance programme on your Fresh milk system using the Primo Compact Fresh Milk Maintenance & service kit.

## PARTS NEEDED:

- Milk Service Kit PN: 1057265
- Pointed Nose Pliers
- Crosshead Screwdriver
- No. 10 Wrench
- No. 8 Socket
- Milkline Cleaner PN: 1053009

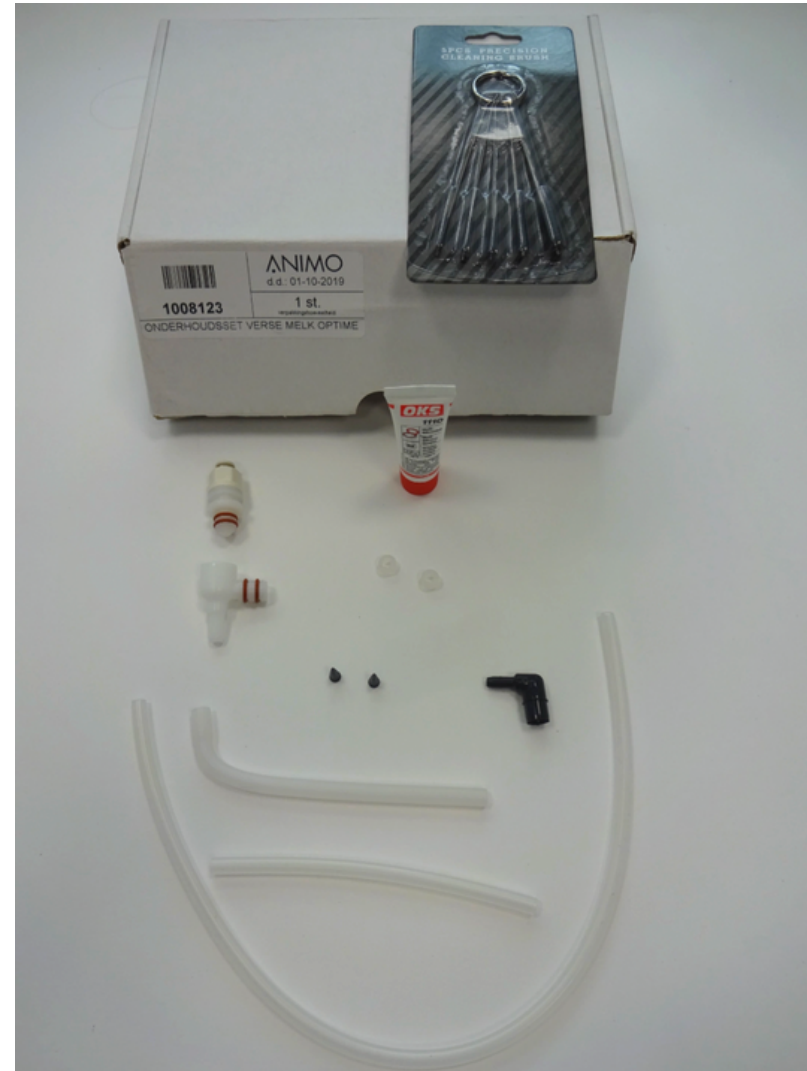


1

Switch off and UNPLUG the Primo Compact from the mains power.



2

Pull the cooler away from the machine and remove the milk tube.

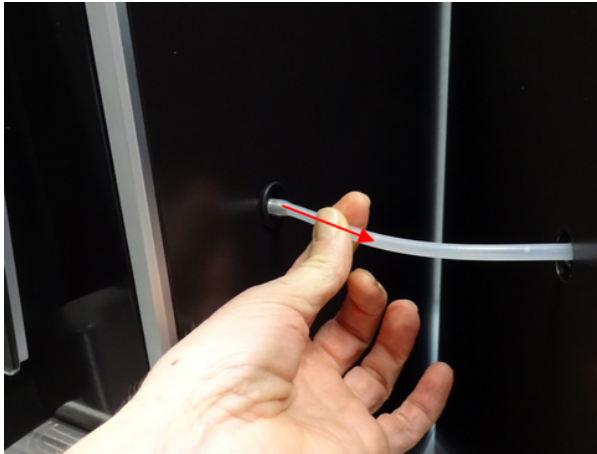


3

Use pointed pliers to remove the pillar from the machine (anti-clockwise)




4

Take off the old duckbill & replace. Screw pillar back into machine & replace cooler.

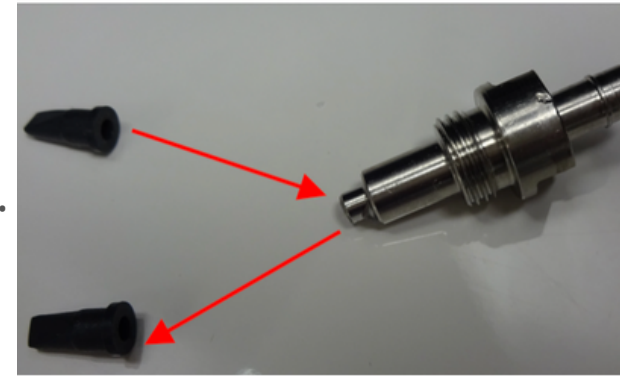

5

Take off the hose from the left/inner side & clean the canal with brush.

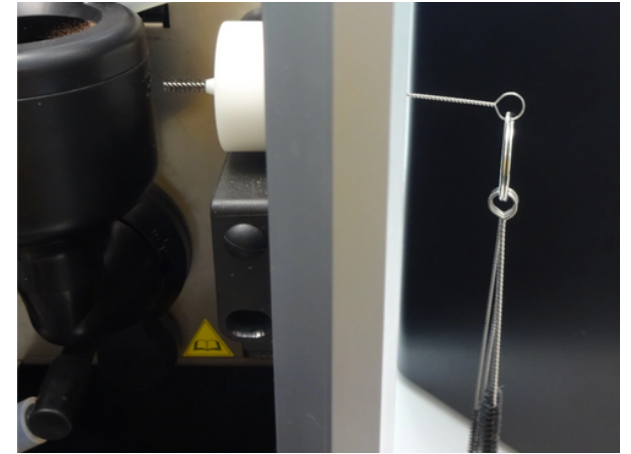

6


Remove the mixer bowl.






7

Take off the milk tube.

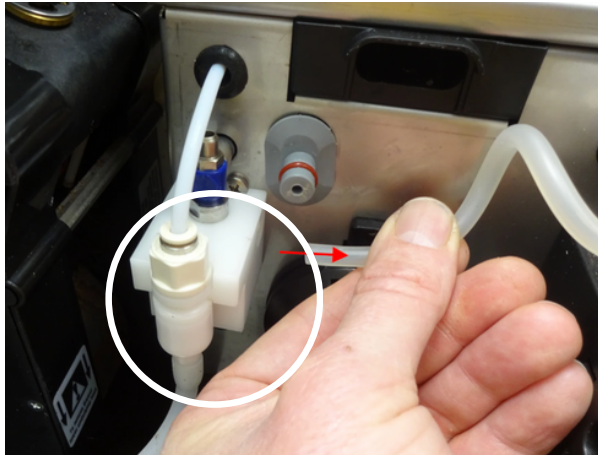


10

Remove the air vent using no. 8 socket (anti-clockwise)

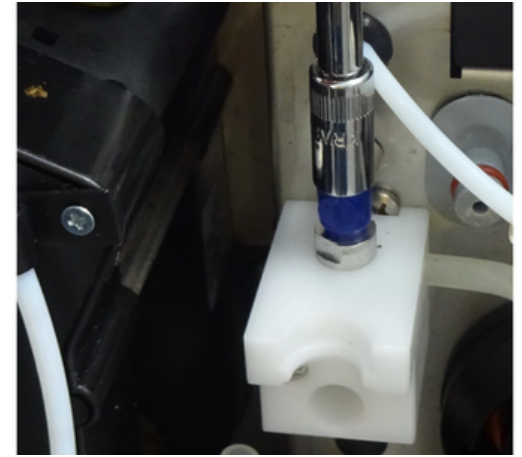


8

Unlock steam hose by pushing upper ring of the fitting on top.

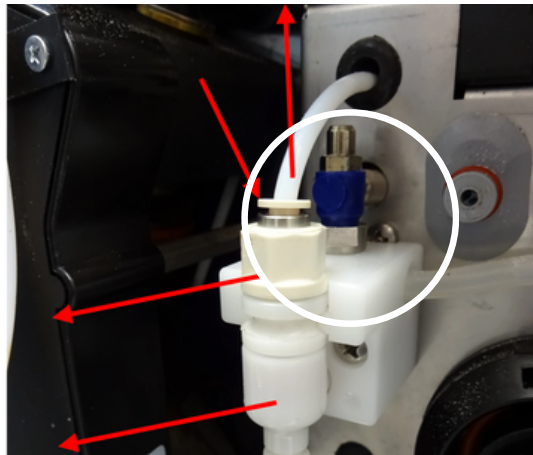


11

Remove the metal socket + duckbill from the white milk adaptor using no. 10 wrench

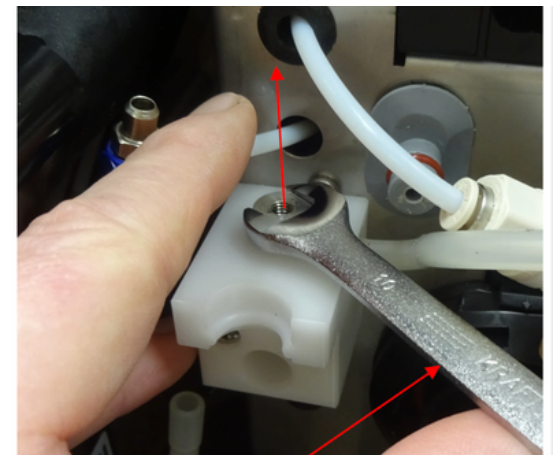


9

Take out steam hose, and remove old venturi from the milk adaptor.

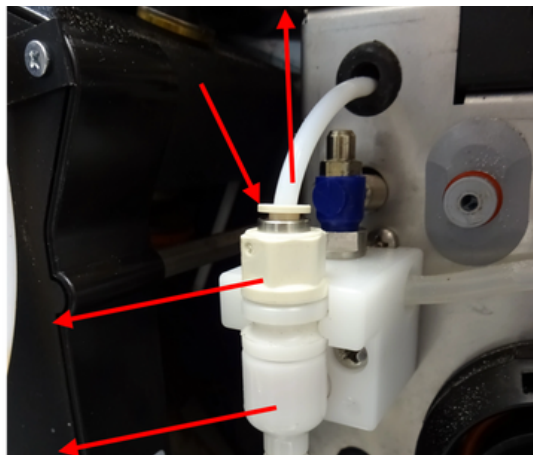

12


Take off the milk adaptor by taking out the 2 screws on the frontside

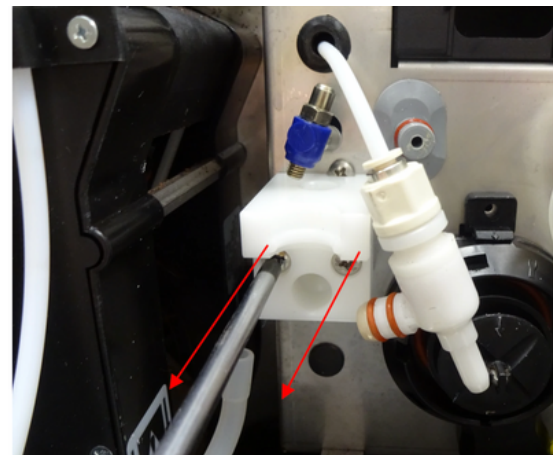




13

Take off the 2 old gaskets.

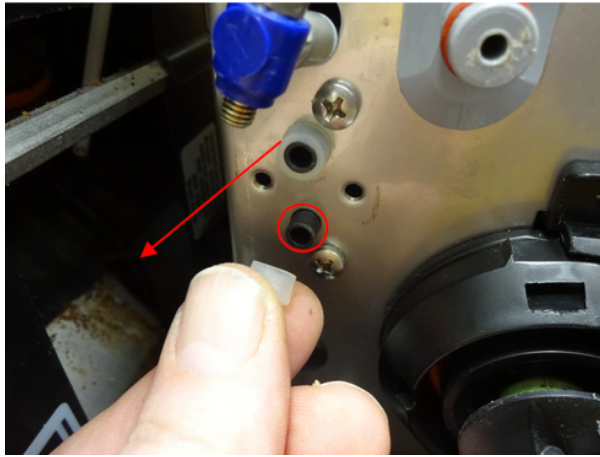


16

Fit the 2 new gaskets included in the kit on the inlet/outlet of the milk pump.

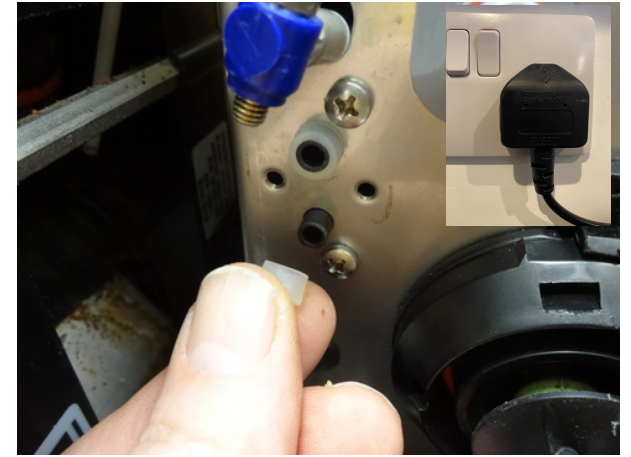


14

Inspect and clean the milk pump canals with the brushes provided with the kit.

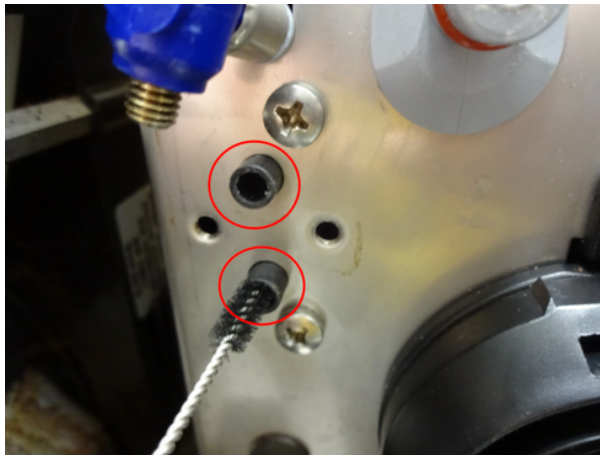


17

Fit the cleaned milk adaptor to the chassis and replace screws.

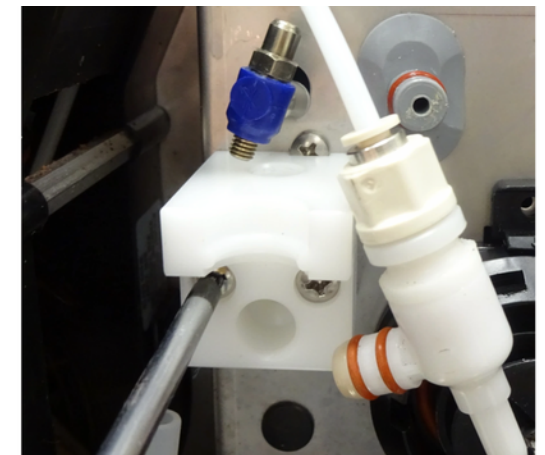


15

Inspect and clean the canals in the white milk adaptor.

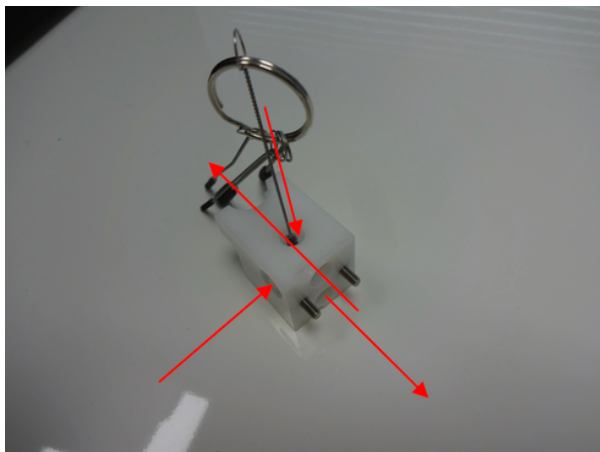


18

Fit the new duckbill to the socket, & fit socket to milk adaptor - tighten.

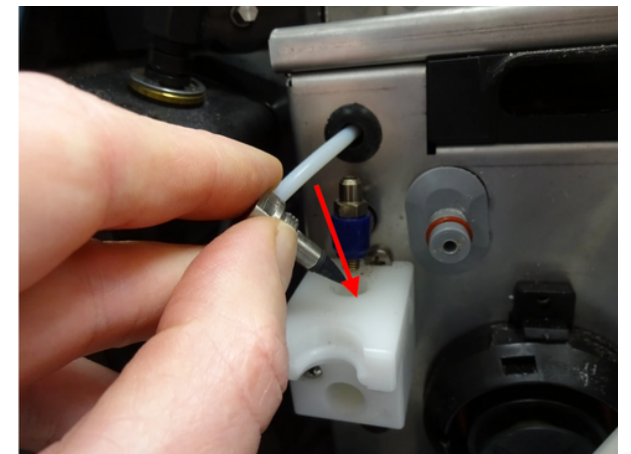


19

Replace the air vent using the socket wrench.

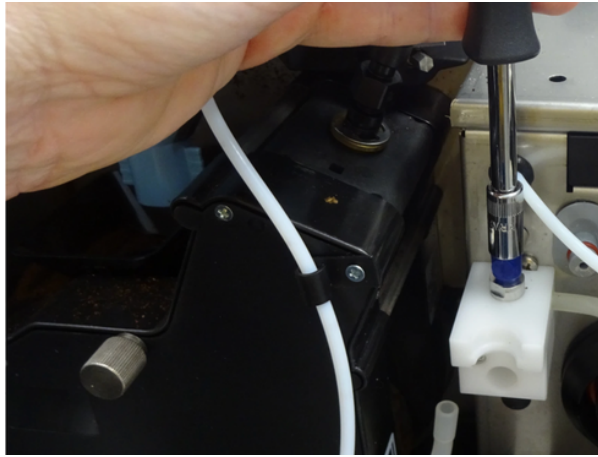


22

Fit to the new tube to both sides of milk adaptor.

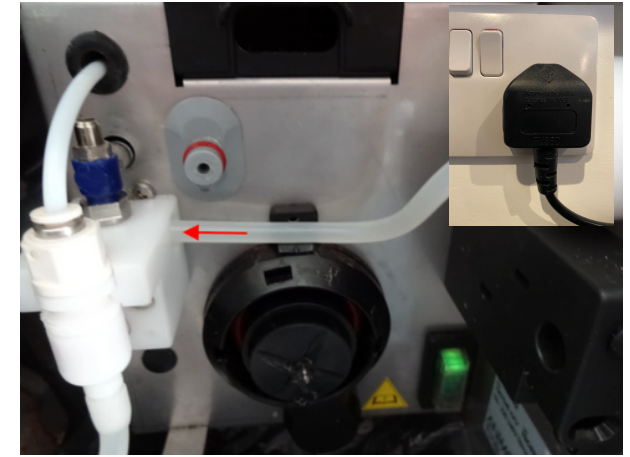


20

Fit the new Venturi to the milk adaptor. Replace steam hose on top.

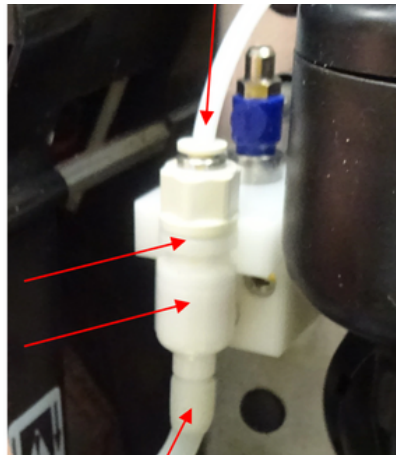


23

Replace the mixer bowl and the outlet to the bracket.

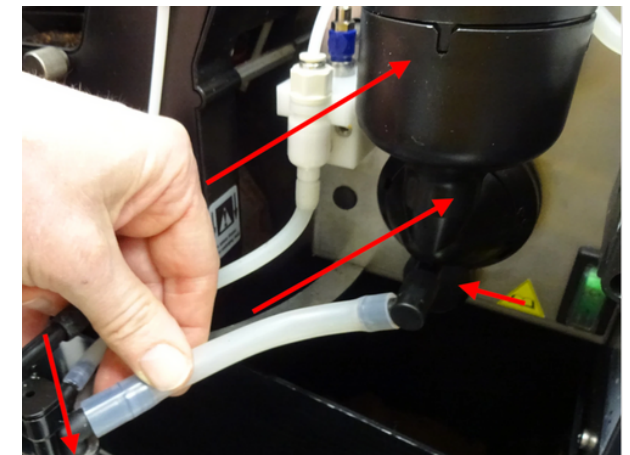


21

Fit the new silicon tube and outlet.

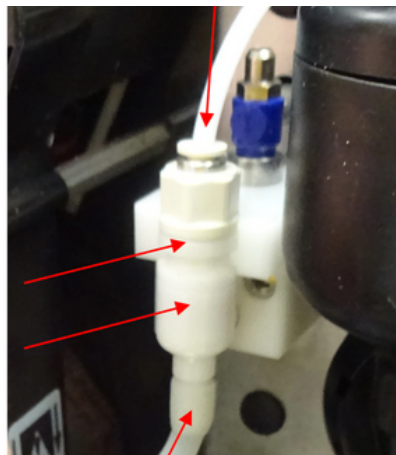


24

Restart the Compact, and let it heat up.

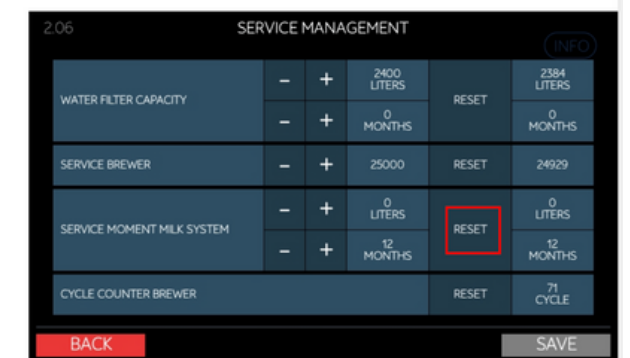

25

Go to 2.06 - service management.  
Reset Service Moment Milk system.

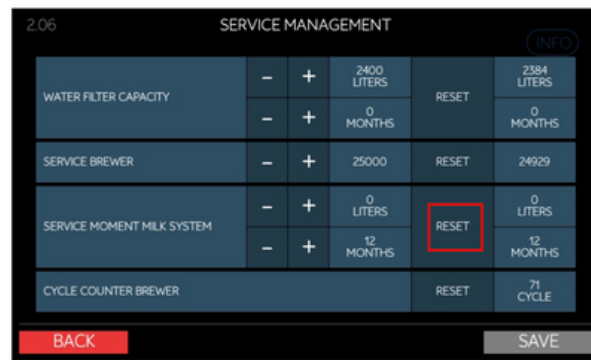

26

Clean milk system with Milk Line cleaner.

Test the milk foam quality by dispensing a cappuccino.







## CONTACT



Westomatic Vending  
Services Ltd,  
Units 7 - 8 Forde Court,  
Block 4 Forde Road,  
Newton Abbot,  
TQ12 4BT

# prigo



+44 (0)1626 323100



[sales@westomatic.com](mailto:sales@westomatic.com)



[www.westomatic.com](http://www.westomatic.com)